

## Ensuring Quality GPS Offsets

A company exploring current technology for GIS data capture was interested in using a TruPulse 360® combined with GPS. They wanted to know how the procedure worked, what kind of accuracy they could achieve and if there was any increased efficiency in fieldwork. This paper will describe what the results were in each of these areas after performing a test with the TruPulse, assuming the use of any GPS.




### The Site

A test course was set up in a local park consisting of 21 features scattered about a parking area of ~ 5 acres. They ranged from sewer & water objects flush to the ground to trees, light poles and signage. The ground was relatively flat with a few small swales for drainage. The 21 objects were surveyed in with an optical total station creating a set of known coordinates for comparison. It is assumed these points are within 1” relative accuracy.

### The Work Flow

A GPS Offset is a mapping technique whereby one occupies a single position with a GPS and derives a coordinate for that spot. Then Distance, Inclination and Azimuth are measured to a remote feature with the TruPulse 360® by sighting on the object and firing the system. This data is then applied to the GPS position, the coordinates of the remote feature are calculated and it is placed on the map. Thus, from a single location, all features that are in view can be mapped by simply measuring to them with the compass/laser. Some important tips for field procedure with the TruPulse 360® were used on this test and are as follows:

- A spot to stand with the laser was chosen that had a clear line of sight to all the objects to be mapped
- The spot was also chosen based on the absence of any large metallic (or other) objects in the vicinity that may distort the magnetic field and affect the accuracy of the compass sensor.
- The GPS and laser setup included a passive antenna placed >6” away from the laser and a data collector >18” away.
- A compass calibration was performed on the TruPulse 360, making sure the PASS indicator was displayed. If it had not passed, proper procedure would need to be checked and verified. If good, a tilt sensor calibration would be performed prior to calibrating the compass again.
- Two methods of mounting the TruPulse were used:
  - Handheld: The GPS unit was kept >18” away from the laser when measuring.
  - Pole mounted: The proximity values above were used and the GPS antenna cable was fixed to the pole so it did not move during laser operation.

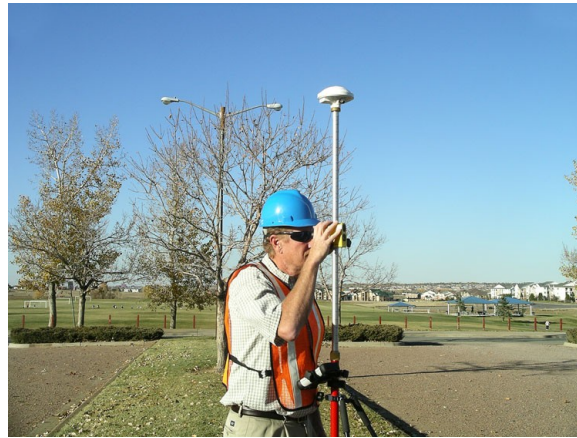

- When targets were measured with the laser, the unit was put into HD mode and the presence of a decimal point in the distance value was always observed. This ensured the distance accuracy was within the +/- 1.0' spec. Whenever the decimal did not come up right away when measuring to a target, the FIRE button was held down for a few more seconds until it did.

### **The Results**

The table below shows the distance of each feature from the measurement point and the amount its position varied from the known coordinates.

Point No.	Description	Distance (feet)	Handheld		Pole Mounted	
			X-Y Error	Z Error	X-Y Error	Z Error
1	Light pole	88	1.15	0.40	1.10	0.32
2	Sewer cap	185	0.51	0.97	1.67	-0.60
3	Curb	141	0.98	0.58	1.36	-0.47
4	Curb	136	1.77	0.04	1.18	0.01
5	Curb	133	0.51	0.91	1.05	-0.23
6	Curb	136	0.84	0.46	0.84	-0.19
7	Curb	149	1.45	-0.31	1.16	-0.15
8	Curb	135	1.63	0.49	1.77	0.02
9	Curb	144	1.27	0.82	1.28	-0.08
10	Curb	212	2.50	0.59	1.18	-0.43
11	Light pole	472	5.69	1.84	3.30	1.18
12	Light pole	232	2.43	-0.05	0.37	0.11
13	Tree	26	0.61	0.38	0.30	0.01
14	Tree	131	1.81	0.24	1.02	-0.13
15	Light pole	228	2.63	0.70	0.31	0.07
16	Sign	348	2.91	1.39	0.29	0.43
17	Tree	250	1.75	-1.40	0.69	-1.18
18	Tree	145	2.06	0.33	1.62	-0.32
19	Tree	428	4.25	-1.00	3.31	-0.88
20	Sewer cap	53	0.99	-0.14	1.38	-0.32
21	Sewer cap	79	1.42	0.39	1.28	0.01

## **Observations**

- Typical accuracy @ <300' when handheld < 2.5'
- Typical accuracy @ <300' when pole mounted < 1.5'
- The maximum error in position increases as the distance to the feature increases. This is primarily due to the possibility of angular error contributed by the compass.
- The time taken to shoot in all 21 points with the laser was ~90 seconds. The time taken to walk to each point with a GPS antenna was ~12 minutes. This does not account for time taken to enter attributes or extra occupation time taken to increase GPS accuracy if needed.

## **Conclusions**

- The final position of a feature will include any error from the laser shot plus any error in the GPS position it is taken from.
- Mounting the TruPulse 360® on a pole increases stability, repeatability and lessens the maximum error in position. This is the preferred method of use.
- If navigating to laser offset positions with GPS to determine their accuracy, any additional error in GPS navigation must also be considered.
- Time savings in using the laser offset method are significant, especially when projected out over an entire work day collecting hundreds of points or an entire project where thousands of positions are required.
- When sub-meter accuracy is required for a project, the use of a pole mounted TruPulse 360® shooting offsets at distances < 300' and a decimeter GPS position will keep final positions within spec.